

Date: Tuesday, 1/16/2007 11:09:16 AM  
 User: Kim Johnston

## Process Sheet

<b>Customer</b> : CU-DAR001 Dart Helicopters Services	<b>Drawing Name</b> : SKIDTUBE ASSEMBLY
<b>Job Number</b> : 30260	
<b>Estimate Number</b> : 10022	
<b>P.O. Number</b> : N/A	<b>Part Number</b> : D205634011
<b>This Issue</b> : 1/16/2007 <b>S.O. No.</b> : N/A	<b>Drawing Number</b> : N/A
<b>Prsht Rev.</b> : NC	<b>Project Number</b> : N/A
<b>First Issue</b> : N/A <b>Type</b> : LANDING GEAR	<b>Drawing Revision</b> : N/A
<b>Previous Run</b> : 30259	<b>Material</b> : N/A
<b>Written By</b> : <u>[Signature]</u>	<b>Due Date</b> : 2/10/2007 <b>Qty:</b> 1 <b>Um:</b> Each
<b>Checked &amp; Approved By</b> : <u>[Signature]</u>	
<b>Comment</b> : Est Rev:P 02.08.28 Removed QC5 from Step 5 KJ	

## Additional Product

Job Number:



<b>Seq. #:</b>	<b>Machine Or Operation:</b>	<b>Description :</b>
----------------	------------------------------	----------------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



①

**Comment:** DOCUMENT CONTROL

Photocopy bluefile &amp; type labels per PPP D205-634-011 CHG004

KS 07-01-31

2.0	30260A	SKID TUBE ASSEMBLY
-----	--------	--------------------

**Comment:** Sub-Component SKID TUBE ASSEMBLYD205-634-041 B 30260A

07/03/14 SQ

3.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------

**Comment:** PACKAGING RESOURCE #1

Pick Packing Kit

4.0	K10003	D205-634-011 Saddle Kit
-----	--------	-------------------------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	K10003	Saddle Kit	<u>30260A</u> 29683
1	D205-634-041	Skidtube Assembly(ref)	<u>B30260A</u>

06/03/14 SQ

5.0	QC4	INSPECT 100% KITS FOR COMPLETENESS
-----	-----	------------------------------------

**Comment:** INSPECT 100% KITS FOR COMPLETENESS

C 7/3/12 U

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes ☒ No ☐ DQA: ☒ Date: 07/03/15

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 1/16/2007 11:09:16 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKIDTUBE ASSEMBLY

Job Number: 30260

Part Number: D205634011

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-011

Location: Rev H

7.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



U 07/03/15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 1/16/2007 11:09:58 AM  
 User: Kim Johnston

## Process Sheet

Customer : CU-DAR001 Dart Helicopters Services Drawing Name : SKID TUBE ASSEMBLY  
 Job Number : 30260A  
 Estimate Number : 10023  
 P.O. Number : N/A Part Number : D205634041  
 This Issue : 1/16/2007 S.O. No. : N/A Drawing Number : D2580 REV C  
 Prsht Rev. : NC Project Number : N/A  
 First Issue : N/A Type : LANDING GEAR Drawing Revision : C  
 Previous Run : 30259A Material : N/A  
 Due Date : 2/10/2007 Qty: 1 Um: Each  
 Written By :  
 Checked & Approved By :  
 Comment : Est Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step  
 30 KJ  
 Est Rev. O 06.02.28 Added paperwork EC

## Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy D205-634 bluefile &amp; type labels per PPP D205-634 CHG001

N/A

2.0 D25001190 Ext'n -1' Beam Tube 4"



Comment: Qty.: 1.0400 Each(s)/Unit Total: 1.0400 Each(s)

Pick:

Qty Part Number Description Batch  
 1 D2500-1-190 Skid Tube Extrusion B 29602

fm / JB 7-2-1

3.0 D2596 205 Web



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch  
 1 D2596 205 Web B 29724

fm / JB 07-05-02

4.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Inspect mat'l D2500-1-190 for damage

2-Cut D2500-1-190 per Dwg D2580 if necessary Deburr ends

3-Acid etch and Alodine tube per QSI 005 4.1

4-Drill pilot holes using drill jig DT 8149(Do not use cutting fluid)

fm / JB 7-2-1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 1/16/2007 11:09:58 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 30260A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

5-Open holes to 0.500" as per Dwg D2580 without cutting fluid *PMC*

6-Countersink holes as per Dwg D2580 without cutting fluid *PMC*

7-Deburr and blow out all chips from inside of tube *PMC*

8-Bond web in place per QSI 015. Allow 12 Hrs. cure time before cutting

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 *M102672*

Sikaflex expire date: *07-02-28*

Start Time: *4:10* Date: *07-02-05*

Fin Time: *8:30 AM* Date: *7-2-9*

*PM 07-02-05*

5.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

1-Bend as per program D2580.C on CNC Bender and Folio FT009

2-Cut tubes as per Dwg. D2580.

*DP 7-2-9*

6.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr ends after cutting. Remove alodine from around holes

*BE 150 7-2-14*

7.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*07-02-20*

8.0

D25763

Step (Machining Detail)



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2576-3 Step *B29486*

*BE 07-02-21*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Tuesday, 1/16/2007 11:09:59 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 30260A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

9.0

D2579

Crossbolt Spacer



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

20

D2579

Spacers

*D27603*

*BE 07-02-21*

10.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Prepare tube for welding D2576-3 StepRemove alodine as required.

*BE 07-02-21*

2-Weld crossbolt spacers D2579 as per Dwg. D2580 and QSI 004.

For D2579 spacers, weld one side, pass 3/8" drill, weld other side, pass 3/8" drill

A/R

Aluminum Rod

*M102756 BE 07-02-21*

3-Grind welds as per Dwg D2580 Grind flush ridge made from bending

4-Drill holes for wearplates using DT 8217Open holes to 19/64", adjust stopper not to hit web. Deburr

5-Counterbore crossbolt spacers to 7/16" ID x 1.0" deep as per Dwg D2580. Deburr holes

*BE 07-02-27*

6-Drill pilot holes for aft cap using DT 8215Open holes to #6 Drill bit. Deburr

7-Drill pilot holes for Tow ring using DT8091, open to .640"and Deburr

8-Weld step D2576 as per Dwg. D2580 and QSI 004

A/R

Aluminum Rod

*M102756 BE 07-02-21*

11.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

*M07/02/270*

12.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

*M07/02/281*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 1/16/2007 11:09:59 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 30260A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

*JS*

*07-03-02①*

14.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

*AP/G.M*

*0703-05①*

15.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

*M-L*

*07/03/07 ①*

16.0

D25771

Wearplate Fwd



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

1

D2577-1

Wearplate

*B29488*

17.0

D25773

Wearplate Aft



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

1

D2577-3

Wearplate

*B29860*

18.0

D25775

Wearplate, Centre



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty

Part Number

Description

Batch

1

D2577-5

Wearplate

*B28639*

*FR/M-L 07/03/07 ①*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 1/16/2007 11:09:59 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 30260A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

19.0

ALS71032130

Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
44	ALS7-1032-130	Inserts	m103495

20.0

AN960JD10L

Washer



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
4 4	AN960JD10L	Washer	m102832

21.0

AN34A

Bolt



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
44	AN3-4A	Bolt	m10087

22.0

D25941

Plug



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

plug

Batch: B29490

23.0

D25943

O-Ring



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

o-ring

Batch: B27168

24.0

D2855

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Cap

Batch: B27488

FL/m-l

07/03/07 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 1/16/2007 11:09:59 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 30260A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

25.0

AN35A

Bolt



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bolt

Batch: m15205

26.0

AN960JD10L

Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Washer

Batch: m102832

27.0

HAND FINISHING1

HAND FINISHING

RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install inserts & wearplates as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates

A/R

Sikaflex-291

Sikaflex expire date: 10/07

2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580

3-Inspect for foreign object per QSI 024

4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive

A/R

Sikaflex-291

Sikaflex expire date: 10/07

5-Wing Walk as per Dwg D2580 and QSI 005 4.4

m103480

Batch:

07/03/08

28.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024

29.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-634-041

Location:

PPP Rev:

PPP B 30260 59

08/03/14

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



Date: Tuesday, 1/16/2007 11:09:59 AM  
User: Kim Johnston

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: SKID TUBE ASSEMBLY

Job Number: 30260A

Part Number: D205634041

Job Number:



Seq. #:

Machine Or Operation:

Description :

30.0

QC21

FINAL INSPECTION/W/O RELEASE



①

Comment: FINAL INSPECTION/W/O RELEASE

FD 02/03/15

Job Completion



u 07/03/15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2580	REV. C SHEET 1 OF 2
DATE 98.08.26		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	

RELEASED  
98/09/17 DS

QTY	Part Number	Description
X	D2580-041	SKIDTUBE ASSEMBLY
*	D2500-1	EXTRUSION
1	D2596	205 WEB
1	D2575	AFT CAP
1	D2576 - 3	STEP
20	D2579	CROSS BOLT SPACER
16	D2594-1	PLUG
16	D2594-3	O-RING
1	D2577-1	WEARSHOE
1	D2577-3	WEARSHOE
1	D2577-5	WEARSHOE
44	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or ALS4-1032-130	INSERT
46	AN3-4A	BOLT
46	AN960JD10L	WASHER

# 00 08.28  
UP 00.08.28

EFFECTIVE DEOS  
98/12/14  
DEO 9124  
DEO 9183


#### GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) LENGTH OF D2500-1 EXTRUSION BEFORE BENDING = 190 INCHES \*
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL  $\varnothing 0.297$  HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (44 PLACES) AFTER FINISH. INSTALL AN3-4A BOLTS AND AN960JD10L WASHERS WITH SIKAFLEX-241.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:  
ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB  
POWDER COAT ASSEMBLY GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3  
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).


Copyright 1996 by DART AEROSPACE LTD

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 30260A


DETAIL A  
SCALE 5:24

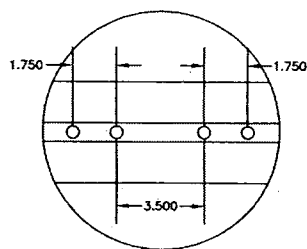


DETAIL B  
SCALE 5:24

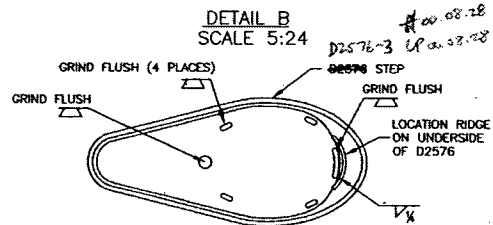

DETAIL C  
SCALE 5:24

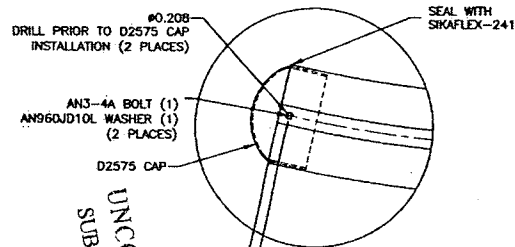


SECTION D-D  
SCALE 5:24

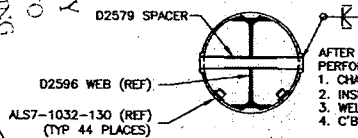


- AFTER DRILLING AND BENDING ASSEMBLY PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
  2. INSERT D2579 SPACER (20 PLACES)
  3. WELD INTO PLACE AND GRIND FLUSH
  4. C'BORE D2579 SPACER TO #0.437 X 1.00 DEEP


D2580-1 DRILLING DETAIL

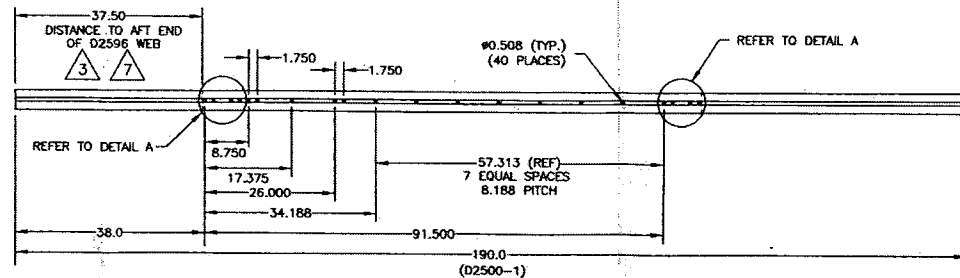

D2580-1 BENDING AND CUTTING DETAIL

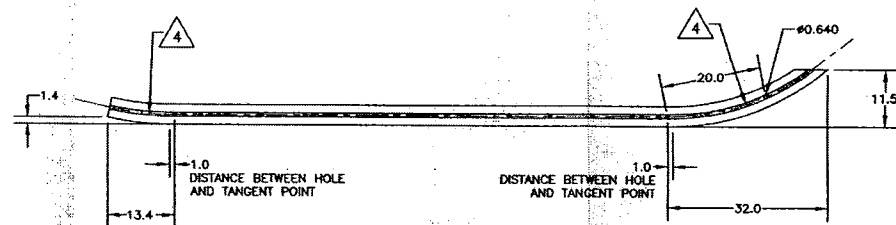

D2580-041 ASSEMBLY DETAIL

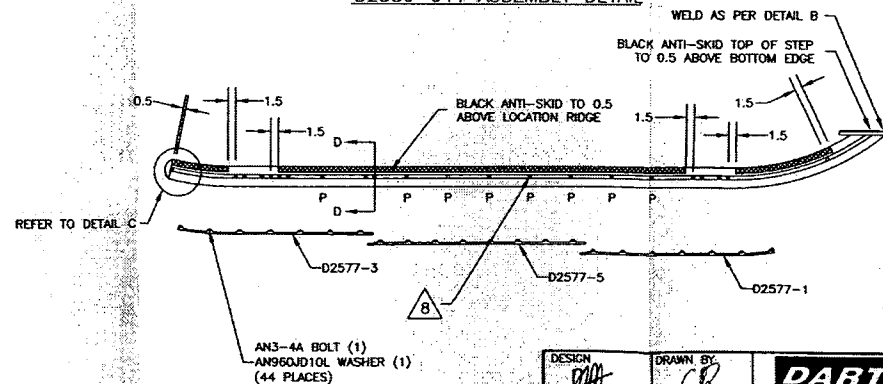

RELEASED  
98/09/17 DS

DESIGN D2580	DRAWN BY CP	<b>DART</b> DART AEROSPACE LTD HARRISBURY, ONTARIO, CANADA	REV. C
CHECKED D2580	APPROVED DS	DRAWING NO. D2580	SHEET 2 OF 2
DATE 98.08.26		TITLE 205 SKIDTUBE ASSEMBLY	SCALE 1:24

**Jason Murdoch**

---

**From:** Bill Beckett [bbeckett@dartaero.com]  
**Sent:** Monday, February 05, 2007 1:10 PM  
**To:** 'Jason Murdoch'  
**Cc:** 'L Lacelle'  
**Subject:** RE: sikaflex-291

Jason,  
Yes.  
Bill

---

**From:** Jason Murdoch [mailto:jmurdoch@dartaero.com]  
**Sent:** February 5, 2007 12:49 PM  
**To:** 'Bill Beckett'  
**Subject:** sikaflex-291

Bill,  
We have 25 tubes of sikaflex-291, batch M102672, that expires at 02/2007. Is it acceptable to use the remainder until the end of this month?

jmurdoch@dartaero.com  
Q.C. COORDINATOR

NO. 94

AWS D17.1.2001  
QUALIFICATION TEST RECORD

Name A Barclay Elliott  
Joint Welding Procedure Tig  
Part number and Job number A205 634041 / B30258 A

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS Tig  
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐  
Current AC ☒ DC ☐ Backing YES ☐ NO ☒  
Position Vertical Down ☐ Up ☐  
Sheet Groove 1G ☐ 2G ☒ 3G ☐ 4G ☐  
Tube Groove 1G ☐ 2G ☒ 5G ☐ 6G ☐  
Sheet Fillet 1F ☐ 2F ☒ 3F ☐ 4F ☐  
Tube Fillet 1F ☐ 2F ☒ 4F ☐ 5F ☐  
Crossbolt Spacer Welded into Skid tube

TEST RESULTS

Visual Pass ☒ Fail ☐  
Penetration Pass ☒ Fail ☐  
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 07/02/89 Qualifier David A. Aival